

**Service Information** 

Self-compensating clutches in passenger cars



## Clutch / XTend type

(with automatic adjustment springs that cannot be seen from the outside)



Fig. 1: The housing stop is not fixed in the delivery condition. When screwing the clutch pressure plate onto the flywheel the catch is locked and is fixed thereafter.

1 Housing stop



Fig. 2: All Xtend clutches are marked with the suffix code symbol E, for example: M 240 E



Fig. 3: Clamping device with centering pin

Manufacturer and source: KLANN Spezial-Werkzeugbau-GmbH, www.klann-online.de

## NOTICE

## **Re-use of XTend pressure plate:**

The housing stop (1) must lift-off from the clutch housing. This may require slight pressure. If the clutch housing stop is not loose, it will trigger the adjustment mechanism. It can then no longer be reset.



**Service Information** 

Self-compensating clutches in passenger cars



## Clutch / type SAC

(with automatic adjustment springs that are visible from the outside)



Fig. 4: Without locking piece

2 Automatic adjustment springs



Fig. 5: With locking piece (BMW)

3 Locking piece

Before installing the clutch disk, check its lateral run-out: max. 0.5 mm. Clutches with a locking piece (3) are centered by using a special centering pin. Remove the locking piece (3) only **after** assembly! (Fig. 5 and Fig. 6) We recommend replacing the pressure plate, clutch disk and release device at the same time.

To prevent functionality problems, such as disengaging problems or judder, following the installation of a self-compensating clutch, please note the following:



Be careful when handling the clutch, otherwise the factory settings can be changed. For the installation and dismantling of the self-compensating pressure plate without a locking piece, use the clamping device with the centering pin (Fig. 3). This will prevent housing distortion and also pedal pulsation and uncontrolled adjustment.



www.zf.com/serviceinformation

ZF Friedrichshafen AG • ZF Services Obere Weiden 12, 97424 Schweinfurt, Germany Technical Support Phone: +49 9721 4755555 Fax: +49 9721 4755556 techsupport.zf-services@zf.com www.zf.com

Fig. 6: With locking piece (Audi, SEAT, Skoda, VW)